

Results by Area

NSPIRE: Other

Scheduled: 12/19/2023

Closed: Dec 20 2023

ID: [REDACTED]

Score: 89.33

Scoring Summary - NSPIRE

Units Inspected: 29 HUD Samp. Size: 29	Outside		Inside		Unit		Totals	
	#	Adj Pts	#	Adj Pts	#	Adj Pts	#	Adj Pts
Life Threatening	0	0.00	0	0.00	1	2.07	1	2.07
Severe	2	0.84	0	0.00	4	2.04	6	2.88
Moderate	1	0.16	0	0.00	28	5.31	29	5.47
Low	0	0.00	0	0.00	3	0.25	3	0.25
Totals	3	1.00	0	0.00	36	9.67	39	10.67

Score	89.33 Note: Score is based on the count of units inspected and not the HUD-defined unit sample size
-------	---

Message	Affirmative findings excluded from score, Repeated items within an area excluded from score
---------	---

Inspection Results

Outside										
SR-2										
Location	Item	Results	Notes	Pic	Date	Fixed	Sev	HUD Pts	Adj Pts	Fix By
Alternate Location - See Notes for Details	Lighting – Auxiliary	Auxiliary lighting component fails to illuminate when tested	Outside unit 216	<u>1</u>	12/19/23 12:31 SC		Severe	0.42	0.42	24H
SR-2 Outside NSPIRE Totals										
Life Threatening: 0/0		Severe: 1/0.42		Moderate: 0/0				Low: 0/0		
SR-4										
Location	Item	Results	Notes	Pic	Date	Fixed	Sev	HUD Pts	Adj Pts	Fix By
Alternate Location - See Notes for Details	Roof Assembly	Roof assembly is damaged		<u>2</u>	12/19/23 14:00 SC		Mod	0.16	0.16	30D
SR-4 Outside NSPIRE Totals										
Life Threatening: 0/0		Severe: 0/0		Moderate: 1/0.16				Low: 0/0		

Inspection Results (Continued)

SR-5

Location	Item	Results	Notes	Pic	Date	Fixed	Sev	HUD Pts	Adj Pts	Fix By
Parking Lot	Sharp Edges	Any item or component has a sharp edge that can puncture or cut		<u>3</u>	12/19/23 14:34 SC		Severe	0.42	0.42	24H

SR-5 Outside NSPIRE Totals

Life Threatening: 0/0 Severe: 1/0.42 Moderate: 0/0 Low: 0/0

Unit

SR-10: Unit 1023

Location	Item	Results	Notes	Pic	Date	Fixed	Sev	HUD Pts	Adj Pts	Fix By
Entire Unit	No Issues/Violations	Inspected - No Issues Were Found			12/19/23 23:22			0.00	0.00 ¹	

SR-10: Unit 1023 Unit NSPIRE Totals

Life Threatening: 0/0 Severe: 0/0 Moderate: 0/0 Low: 0/0

SR-10: Unit 1027

Location	Item	Results	Notes	Pic	Date	Fixed	Sev	HUD Pts	Adj Pts	Fix By
Bedroom 1	Window	A unit window screen has a hole, tear, or cut of more than one inch		<u>4</u>	12/19/23 17:43 SC		Mod	0.19	0.19 ³	30D
Living Room	Window	A unit window screen has a hole, tear, or cut of more than one inch		<u>5</u>	12/19/23 17:45 SC		Mod	0.19	0.19 ³	30D

SR-10: Unit 1027 Unit NSPIRE Totals

Life Threatening: 0/0 Severe: 0/0 Moderate: 2/0.38 Low: 0/0

SR-10: Unit 1037

Location	Item	Results	Notes	Pic	Date	Fixed	Sev	HUD Pts	Adj Pts	Fix By
Bedroom 1	Window	A unit window screen has a hole, tear, or cut of more than one inch		<u>6</u>	12/19/23 17:36 SC		Mod	0.19	0.19	30D

SR-10: Unit 1037 Unit NSPIRE Totals

Life Threatening: 0/0 Severe: 0/0 Moderate: 1/0.19 Low: 0/0

SR-10: Unit 1038

Location	Item	Results	Notes	Pic	Date	Fixed	Sev	HUD Pts	Adj Pts	Fix By
Dining Room	Window	A unit window will not open or stay open		<u>7</u>	12/19/23 17:28 SC		Mod	0.19	0.19	30D
Living Room	Window	A unit window screen has a hole, tear, or cut of more than one inch		<u>8</u>	12/19/23 17:26 SC		Mod	0.19	0.19	30D

SR-10: Unit 1038 Unit NSPIRE Totals

Life Threatening: 0/0 Severe: 0/0 Moderate: 2/0.38 Low: 0/0

SR-11: Unit 1121

Location	Item	Results	Notes	Pic	Date	Fixed	Sev	HUD Pts	Adj Pts	Fix By
Living Room	Window	A unit window screen has a hole, tear, or cut of more than one inch		<u>9</u>	12/19/23 16:36 SC		Mod	0.19	0.19 ³	30D
Living Room	Window	A unit window screen has a hole, tear, or cut of more than one inch		<u>9</u>	12/19/23 16:30 SC		Mod	0.19	0.19 ³	30D

SR-11: Unit 1121 Unit NSPIRE Totals

Life Threatening: 0/0 Severe: 0/0 Moderate: 2/0.38 Low: 0/0

¹Non-Scoring ²Affirmative Non-Scoring ³Repeat finding within the area (only 1-scored)

Inspection Results (Continued)

SR-11: Unit 1126

Location	Item	Results	Notes	Pic	Date	Fixed	Sev	HUD Pts	Adj Pts	Fix By
Entire Unit	No Issues/Violations	Inspected - No Issues Were Found			12/19/23 22:24			0.00	0.00 ¹	

SR-11: Unit 1126 Unit NSPIRE Totals

Life Threatening: 0/0 Severe: 0/0 Moderate: 0/0 Low: 0/0

SR-2: Unit 0211

Location	Item	Results	Notes	Pic	Date	Fixed	Sev	HUD Pts	Adj Pts	Fix By
Entire Unit	No Issues/Violations	Inspected - No Issues Were Found			12/19/23 18:45			0.00	0.00 ¹	

SR-2: Unit 0211 Unit NSPIRE Totals

Life Threatening: 0/0 Severe: 0/0 Moderate: 0/0 Low: 0/0

SR-2: Unit 0215

Location	Item	Results	Notes	Pic	Date	Fixed	Sev	HUD Pts	Adj Pts	Fix By
Alternate Location - See Notes for Details	Door Hardware - Entry (non-fire)	Entry door component is damaged, inoperable, or missing (does not affect privacy or security)		10	12/19/23 12:10 SC		Low	0.08	0.08	60D
Bathroom 2	Conductors, Outlets, Switches	Exposed electrical conductor		11	12/19/23 12:18 SC		LT	2.07	2.07 ³	24H
Bathroom 2	Toilet	Toilet components are damaged and inoperable		12	12/19/23 12:17 SC		Mod	0.19	0.19	30D
Bedroom 2	Conductors, Outlets, Switches	Exposed electrical conductor		13	12/19/23 12:14 SC		LT	2.07	2.07 ³	24H
Closet/Storage Area	Door - General	Closet door component is missing, damaged or inoperable		14	12/19/23 12:15 SC		Low	0.08	0.08	60D
Kitchen	Infestation	Evidence of cockroaches (Live, Dead, or Other Evidence)		15	12/19/23 12:23 SC		Mod	0.19	0.19	30D
Laundry Room	GFCI/AFCI	Missing GFCI protection on outlet within Six Feet of water source		16	12/19/23 12:21 SC		Severe	0.00	0.00 ²	24H

SR-2: Unit 0215 Unit NSPIRE Totals

Life Threatening: 2/4.14 Severe: 1/0 Moderate: 2/0.38 Low: 2/0.17

SR-3: Unit 0314

Location	Item	Results	Notes	Pic	Date	Fixed	Sev	HUD Pts	Adj Pts	Fix By
Laundry Room	GFCI/AFCI	Missing GFCI protection on outlet within Six Feet of water source		17	12/19/23 12:59 SC		Severe	0.00	0.00 ²	24H
Living Room	Infestation	Evidence of cockroaches (Live, Dead, or Other Evidence)		18	12/19/23 12:56 SC		Mod	0.19	0.19	30D

SR-3: Unit 0314 Unit NSPIRE Totals

Life Threatening: 0/0 Severe: 1/0 Moderate: 1/0.19 Low: 0/0

SR-3: Unit 0323

Location	Item	Results	Notes	Pic	Date	Fixed	Sev	HUD Pts	Adj Pts	Fix By
Entire Unit	No Issues/Violations	Not Inspected - Aggressive Pet(s)			12/19/23 18:50			0.00	0.00 ¹	

SR-3: Unit 0323 Unit NSPIRE Totals

Life Threatening: 0/0 Severe: 0/0 Moderate: 0/0 Low: 0/0

¹Non-Scoring ²Affirmative Non-Scoring ³Repeat finding within the area (only 1-scored)

Inspection Results (Continued)

SR-4: Unit 0412

Location	Item	Results	Notes	Pic	Date	Fixed	Sev	HUD Pts	Adj Pts	Fix By
Bedroom 1	Sharp Edges	Any item or component has a sharp edge that can puncture or cut		19	12/19/23 13:51 SC		Severe	0.51	0.51	24H
Bedroom 1	Window	A unit window pane, sash, or frame is damaged or missing		20	12/19/23 13:50 SC		Mod	0.19	0.19	30D
Dining Room	Window	A unit window screen has a hole, tear, or cut of more than one inch		21	12/19/23 13:49 SC		Mod	0.19	0.19	30D
SR-4: Unit 0412 Unit NSPIRE Totals										
Life Threatening: 0/0		Severe: 1/0.51		Moderate: 2/0.38				Low: 0/0		

SR-4: Unit 0415

Location	Item	Results	Notes	Pic	Date	Fixed	Sev	HUD Pts	Adj Pts	Fix By
Kitchen	Infestation	Evidence of cockroaches (Live, Dead, or Other Evidence)		22	12/19/23 13:40 SC		Mod	0.19	0.19	30D
SR-4: Unit 0415 Unit NSPIRE Totals										
Life Threatening: 0/0		Severe: 0/0		Moderate: 1/0.19				Low: 0/0		

SR-4: Unit 0418

Location	Item	Results	Notes	Pic	Date	Fixed	Sev	HUD Pts	Adj Pts	Fix By
Alternate Location - See Notes for Details	GFCI/AFCI	GFCI outlet or GFCI breaker reset button does not test (No visible damage)	Service panel	23	12/19/23 13:30 SC		Severe	0.51	0.51	24H
Bedroom 1	Window	A unit window screen has a hole, tear, or cut of more than one inch		24	12/19/23 13:34 SC		Mod	0.19	0.19	30D
SR-4: Unit 0418 Unit NSPIRE Totals										
Life Threatening: 0/0		Severe: 1/0.51		Moderate: 1/0.19				Low: 0/0		

SR-4: Unit 0428

Location	Item	Results	Notes	Pic	Date	Fixed	Sev	HUD Pts	Adj Pts	Fix By
Kitchen	Refrigerator	Refrigerator door seal is damaged		25	12/19/23 13:22 SC		Mod	0.19	0.19	30D
Laundry Room	GFCI/AFCI	Missing GFCI protection on outlet within Six Feet of water source		26	12/19/23 13:18 SC		Severe	0.00	0.00 ²	24H
SR-4: Unit 0428 Unit NSPIRE Totals										
Life Threatening: 0/0		Severe: 1/0		Moderate: 1/0.19				Low: 0/0		

SR-5: Unit 0524

Location	Item	Results	Notes	Pic	Date	Fixed	Sev	HUD Pts	Adj Pts	Fix By
Bathroom 1	Bathtub/Shower	Bath/shower components damaged, missing, or inoperable		27	12/19/23 14:23 SC		Mod	0.19	0.19	30D
Kitchen	Cooking Appliance	A Stove Burner is Inoperable (with at least one operable burner)		28	12/19/23 14:20 SC		Mod	0.19	0.19	30D
SR-5: Unit 0524 Unit NSPIRE Totals										
Life Threatening: 0/0		Severe: 0/0		Moderate: 2/0.38				Low: 0/0		

¹Non-Scoring ²Affirmative Non-Scoring ³Repeat finding within the area (only 1-scored)

Inspection Results (Continued)

SR-5: Unit 0534

Location	Item	Results	Notes	Pic	Date	Fixed	Sev	HUD Pts	Adj Pts	Fix By
Alternate Location - See Notes for Details	GFCI/AFCI	GFCI outlet or GFCI breaker reset button does not test (No visible damage)	Service panel	29	12/19/23 14:12 SC		Severe	0.51	0.51	24H

SR-5: Unit 0534 Unit NSPIRE Totals

Life Threatening: 0/0 Severe: 1/0.51 Moderate: 0/0 Low: 0/0

SR-6: Unit 0613

Location	Item	Results	Notes	Pic	Date	Fixed	Sev	HUD Pts	Adj Pts	Fix By
Entire Unit	No Issues/Violations	Inspected - No Issues Were Found			12/19/23 21:44			0.00	0.00 ¹	

SR-6: Unit 0613 Unit NSPIRE Totals

Life Threatening: 0/0 Severe: 0/0 Moderate: 0/0 Low: 0/0

SR-6: Unit 0616

Location	Item	Results	Notes	Pic	Date	Fixed	Sev	HUD Pts	Adj Pts	Fix By
Bedroom 1	Floor Covering and Finish	10% or more of the floor substrate area is exposed in any room		30	12/19/23 15:20 SC		Mod	0.19	0.19	30D
Bedroom 1	Window	A unit window screen has a hole, tear, or cut of more than one inch		31	12/19/23 15:19 SC		Mod	0.19	0.19	30D

SR-6: Unit 0616 Unit NSPIRE Totals

Life Threatening: 0/0 Severe: 0/0 Moderate: 2/0.38 Low: 0/0

SR-6: Unit 0618

Location	Item	Results	Notes	Pic	Date	Fixed	Sev	HUD Pts	Adj Pts	Fix By
Living Room	Window	A unit window screen has a hole, tear, or cut of more than one inch			12/19/23 15:05 SC		Mod	0.19	0.19	30D

SR-6: Unit 0618 Unit NSPIRE Totals

Life Threatening: 0/0 Severe: 0/0 Moderate: 1/0.19 Low: 0/0

SR-6: Unit 0632

Location	Item	Results	Notes	Pic	Date	Fixed	Sev	HUD Pts	Adj Pts	Fix By
Alternate Location - See Notes for Details	Door Surface - Entry (non-fire)	Gap of 1/4" around door seal/gasket & light penetration		32	12/19/23 15:35 SC		Mod	0.19	0.19	30D
Dining Room	Window	A unit window screen has a hole, tear, or cut of more than one inch		33	12/19/23 15:33 SC		Mod	0.19	0.19	30D

SR-6: Unit 0632 Unit NSPIRE Totals

Life Threatening: 0/0 Severe: 0/0 Moderate: 2/0.38 Low: 0/0

SR-6: Unit 0637

Location	Item	Results	Notes	Pic	Date	Fixed	Sev	HUD Pts	Adj Pts	Fix By
Bathroom 2	Door – General	A passage door component is damaged/missing/inoperable		34	12/19/23 14:44 SC		Low	0.08	0.08	60D
Bedroom 1	Window	A unit window screen has a hole, tear, or cut of more than one inch		35	12/19/23 14:40 SC		Mod	0.19	0.19	30D

SR-6: Unit 0637 Unit NSPIRE Totals

Life Threatening: 0/0 Severe: 0/0 Moderate: 1/0.19 Low: 1/0.08

¹Non-Scoring ²Affirmative Non-Scoring ³Repeat finding within the area (only 1-scored)

Inspection Results (Continued)

SR-7: Unit 0737

Location	Item	Results	Notes	Pic	Date	Fixed	Sev	HUD Pts	Adj Pts	Fix By
Kitchen	Infestation	Evidence of cockroaches (Live, Dead, or Other Evidence)		36	12/19/23 15:56 SC		Mod	0.19	0.19	30D
Living Room	Window	A unit window screen has a hole, tear, or cut of more than one inch		37	12/19/23 15:53 SC		Mod	0.19	0.19	30D

SR-7: Unit 0737 Unit NSPIRE Totals

Life Threatening: 0/0 Severe: 0/0 Moderate: 2/0.38 Low: 0/0

SR-7: Unit 0738

Location	Item	Results	Notes	Pic	Date	Fixed	Sev	HUD Pts	Adj Pts	Fix By
Dining Room	Window	A unit window screen has a hole, tear, or cut of more than one inch		38	12/19/23 16:09 SC		Mod	0.19	0.19	30D

SR-7: Unit 0738 Unit NSPIRE Totals

Life Threatening: 0/0 Severe: 0/0 Moderate: 1/0.19 Low: 0/0

SR-8: Unit 0821

Location	Item	Results	Notes	Pic	Date	Fixed	Sev	HUD Pts	Adj Pts	Fix By
Entire Unit	No Issues/Violations	Inspected - No Issues Were Found			12/20/23 16:12			0.00	0.00 ¹	

SR-8: Unit 0821 Unit NSPIRE Totals

Life Threatening: 0/0 Severe: 0/0 Moderate: 0/0 Low: 0/0

SR-8: Unit 0823

Location	Item	Results	Notes	Pic	Date	Fixed	Sev	HUD Pts	Adj Pts	Fix By
Bedroom 1	Window	A unit window pane, sash, or frame is damaged or missing		39	12/20/23 10:02 SC		Mod	0.19	0.19	30D

SR-8: Unit 0823 Unit NSPIRE Totals

Life Threatening: 0/0 Severe: 0/0 Moderate: 1/0.19 Low: 0/0

SR-8: Unit 0826

Location	Item	Results	Notes	Pic	Date	Fixed	Sev	HUD Pts	Adj Pts	Fix By
Kitchen	Refrigerator	Refrigerator door seal is damaged		40	12/20/23 10:16 SC		Mod	0.19	0.19	30D

SR-8: Unit 0826 Unit NSPIRE Totals

Life Threatening: 0/0 Severe: 0/0 Moderate: 1/0.19 Low: 0/0

SR-8: Unit 0833

Location	Item	Results	Notes	Pic	Date	Fixed	Sev	HUD Pts	Adj Pts	Fix By
Living Room	Window	A unit window screen has a hole, tear, or cut of more than one inch		41	12/20/23 09:55 SC		Mod	0.19	0.19	30D

SR-8: Unit 0833 Unit NSPIRE Totals

Life Threatening: 0/0 Severe: 0/0 Moderate: 1/0.19 Low: 0/0

SR-9: Unit 0917

Location	Item	Results	Notes	Pic	Date	Fixed	Sev	HUD Pts	Adj Pts	Fix By
Bedroom 1	GFCI/AFCI	GFCI outlet or GFCI breaker reset button does not test (No visible damage)		42	12/19/23 17:09 SC		Severe	0.51	0.51	24H
Kitchen	Infestation	Evidence of cockroaches (Live, Dead, or Other Evidence)		43	12/19/23 17:07 SC		Mod	0.19	0.19	30D

¹Non-Scoring ²Affirmative Non-Scoring ³Repeat finding within the area (only 1-scored)

SR-9: Unit 0917 Unit NSPIRE Totals										
Life Threatening: 0/0		Severe: 1/0.51			Moderate: 1/0.19				Low: 0/0	
SR-9: Unit 0922										
Location	Item	Results	Notes	Pic	Date	Fixed	Sev	HUD Pts	Adj Pts	Fix By
Entire Unit	No Issues/Violations	Inspected - No Issues Were Found			12/20/23 15:46			0.00	0.00 ¹	
SR-9: Unit 0922 Unit NSPIRE Totals										
Life Threatening: 0/0		Severe: 0/0			Moderate: 0/0				Low: 0/0	
SR-9: Unit 0936										
Location	Item	Results	Notes	Pic	Date	Fixed	Sev	HUD Pts	Adj Pts	Fix By
Entire Unit	No Issues/Violations	Inspected - No Issues Were Found			12/19/23 23:01			0.00	0.00 ¹	
SR-9: Unit 0936 Unit NSPIRE Totals										
Life Threatening: 0/0		Severe: 0/0			Moderate: 0/0				Low: 0/0	

Inspection Photos

Outside


SR-2



1

SR-2 - Alternate Location - See Notes for
Details - Lighting – Auxiliary - Dec 19
2023 12:31PM - [REDACTED] CAPTION:
Outside unit 216

SR-4

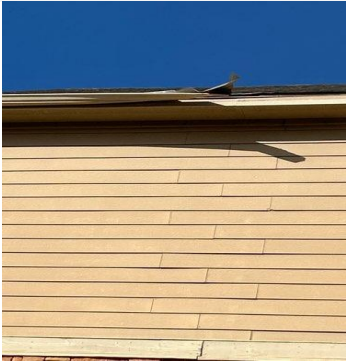

2

SR-4 - Alternate Location - See Notes for
Details - Roof Assembly - Dec 19 2023
2:00PM - [REDACTED]

SR-5



3

SR-5 - Parking Lot - Sharp Edges - Dec
19 2023 2:34PM - [REDACTED]

Inspection Photos (Continued)

Unit

SR-10: Unit 1027



4



5

SR-10 Unit 1027 - Bedroom 1 - Window -
Dec 19 2023 5:43PM - [REDACTED]

SR-10 Unit 1027 - Living Room - Window
- Dec 19 2023 5:45PM - [REDACTED]

SR-10: Unit 1037




6

SR-10 Unit 1037 - Bedroom 1 - Window -
Dec 19 2023 5:36PM - [REDACTED]

SR-10: Unit 1038



7

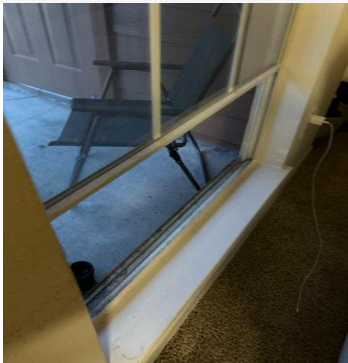

8

SR-10 Unit 1038 - Dining Room - Window
- Dec 19 2023 5:28PM - [REDACTED]

SR-10 Unit 1038 - Living Room - Window
- Dec 19 2023 5:26PM - [REDACTED]

Inspection Photos (Continued)

SR-11: Unit 1121



9

SR-11 Unit 1121 - Living Room - Window
- Dec 19 2023 4:30PM - [REDACTED]

SR-2: Unit 0215



10

SR-2 Unit 0215 - Alternate Location - See
Notes for Details - Door Hardware - Entry
(non-fire) - Dec 19 2023 12:10PM - [REDACTED]



11

SR-2 Unit 0215 - Bathroom 2 -
Conductors, Outlets, Switches - Dec 19
2023 12:18PM - [REDACTED]



12

SR-2 Unit 0215 - Bathroom 2 - Toilet -
Dec 19 2023 12:17PM - [REDACTED]



13

SR-2 Unit 0215 - Bedroom 2 -
Conductors, Outlets, Switches - Dec 19
2023 12:14PM - [REDACTED]



14

SR-2 Unit 0215 - Closet/Storage Area -
Door - General - Dec 19 2023 12:15PM - [REDACTED]



15

SR-2 Unit 0215 - Kitchen - Infestation -
Dec 19 2023 12:23PM - [REDACTED]



16

SR-2 Unit 0215 - Laundry Room -
GFCI/AFCI - Dec 19 2023 12:21PM - [REDACTED]

Inspection Photos (Continued)

SR-3: Unit 0314



17

SR-3 Unit 0314 - Laundry Room -
GFCI/AFCI - Dec 19 2023 12:59PM - [REDACTED]



18

SR-3 Unit 0314 - Living Room -
Infestation - Dec 19 2023 12:56PM - [REDACTED]

SR-4: Unit 0412



19

SR-4 Unit 0412 - Bedroom 1 - Sharp
Edges - Dec 19 2023 1:51PM - [REDACTED]



20

SR-4 Unit 0412 - Bedroom 1 - Window -
Dec 19 2023 1:50PM - [REDACTED]



21

SR-4 Unit 0412 - Dining Room - Window
- Dec 19 2023 1:49PM - [REDACTED]

SR-4: Unit 0415



22

SR-4 Unit 0415 - Kitchen - Infestation -
Dec 19 2023 1:40PM - [REDACTED]

Inspection Photos (Continued)

SR-4: Unit 0418



23



24


SR-4 Unit 0418 - Alternate Location - See Notes for Details - GFCI/AFCI - Dec 19 2023 1:30PM - [REDACTED] CAPTION: Service panel

SR-4 Unit 0418 - Bedroom 1 - Window - Dec 19 2023 1:34PM - [REDACTED]

SR-4: Unit 0428



25

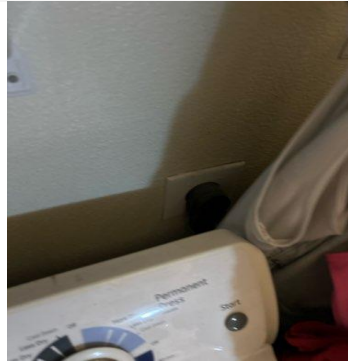

26

SR-4 Unit 0428 - Kitchen - Refrigerator - Dec 19 2023 1:22PM - [REDACTED]

SR-4 Unit 0428 - Laundry Room - GFCI/AFCI - Dec 19 2023 1:18PM - [REDACTED]

SR-5: Unit 0524



27



28

SR-5 Unit 0524 - Bathroom 1 - Bathtub/Shower - Dec 19 2023 2:23PM - [REDACTED]

SR-5 Unit 0524 - Kitchen - Cooking Appliance - Dec 19 2023 2:20PM - [REDACTED]

Inspection Photos (Continued)

SR-5: Unit 0534



29

SR-5 Unit 0534 - Alternate Location - See
Notes for Details - GFCI/AFCI - Dec 19
2023 2:12PM - [REDACTED] CAPTION:
Service panel

SR-6: Unit 0616



30

SR-6 Unit 0616 - Bedroom 1 - Floor
Covering and Finish - Dec 19 2023
3:20PM - [REDACTED]



31

SR-6 Unit 0616 - Bedroom 1 - Window -
Dec 19 2023 3:19PM - [REDACTED]

SR-6: Unit 0632



32

SR-6 Unit 0632 - Alternate Location - See
Notes for Details - Door Surface - Entry
(non-fire) - Dec 19 2023 3:35PM - [REDACTED]




33

SR-6 Unit 0632 - Dining Room - Window
- Dec 19 2023 3:33PM - [REDACTED]

Inspection Photos (Continued)

SR-6: Unit 0637

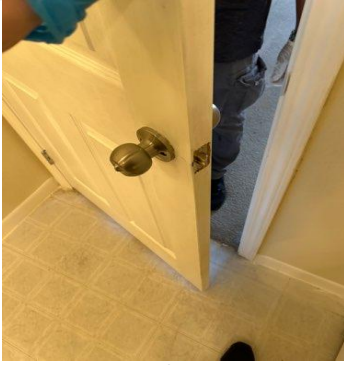

34



35

SR-6 Unit 0637 - Bathroom 2 - Door –
General - Dec 19 2023 2:44PM - [REDACTED]

SR-6 Unit 0637 - Bedroom 1 - Window -
Dec 19 2023 2:40PM - [REDACTED]

SR-7: Unit 0737



36



37

SR-7 Unit 0737 - Kitchen - Infestation -
Dec 19 2023 3:56PM - [REDACTED]

SR-7 Unit 0737 - Living Room - Window -
Dec 19 2023 3:53PM - [REDACTED]

SR-7: Unit 0738



38

SR-7 Unit 0738 - Dining Room - Window
- Dec 19 2023 4:09PM - [REDACTED]

Inspection Photos (Continued)

SR-8: Unit 0823



39

SR-8 Unit 0823 - Bedroom 1 - Window -
Dec 20 2023 10:02AM - [REDACTED]

SR-8: Unit 0826



40

SR-8 Unit 0826 - Kitchen - Refrigerator -
Dec 20 2023 10:16AM - [REDACTED]

SR-8: Unit 0833



41

SR-8 Unit 0833 - Living Room - Window -
Dec 20 2023 9:55AM - [REDACTED]

Inspection Photos (Continued)

SR-9: Unit 0917



42

SR-9 Unit 0917 - Bedroom 1 - GFCI/AFCI
- Dec 19 2023 5:09PM - [REDACTED]



43

SR-9 Unit 0917 - Kitchen - Infestation -
Dec 19 2023 5:07PM - [REDACTED]